



Photo 15: View of left engine as received at engine inspection facility.